



PG25 Pro Thunderbolt™ 5 Dock

Quick Start Guide



Systems Requirements

- Supported Operating Systems
 - Windows® 10 or later
 - Mac OS® 11 or later

Package Contents

- Thunderbolt 5 Dock
- Thunderbolt 5 Certified Cable
- External Power Supply
- Digital Quick Start Guide
- Metal Mounting Plate

I/O Ports


Front



Item	Description
1. 3.5mm Audio jack	Supports audio output and microphone input
2. USB-A 3.2 Gen 2 (10Gb/s) ports	USB Device connection port
3. USB-C 3.2 Gen 2 (10Gb/s) port	USB Device connection port
4. Thunderbolt 5 140W upstream port	Thunderbolt 5 with PD3.1 charging to laptop
5. Host connectivity indicator	LED glows amber when host port is connected
6. Power indicator	LED glows green when power on
7. Power button	Power on/off


PROGRADE

Rear

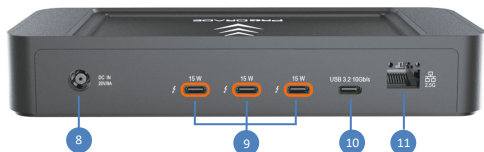

Item	Description
8. Power port	DC IN 20V/9A
9. Thunderbolt 5 15W downstream ports (80Gb/s)	Connect to Thunderbolt/USB device
10. USB-C 3.2 Gen 2 port (10Gb/s)	USB device connection port
11. 2.5GbE Ethernet port	Connect to a wired network

Side


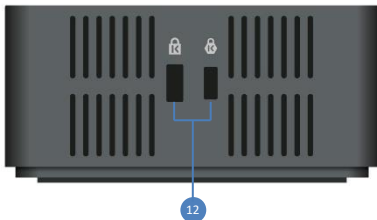


Item	Description
12. Kensington lock	Security device used to physically secure the dock






Specifications

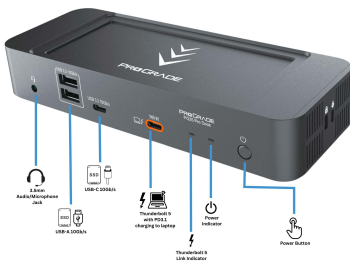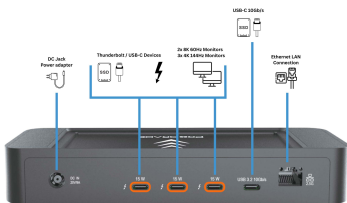User Interface	Upstream	Thunderbolt 5, supports up to PD3.1 at 140W with 180W power supply
	Downstream	Thunderbolt 5 ports (15W) x3
		USB-A 3.2 Gen 2 ports (5V/1.5A) x2
		USB-C 3.2 Gen 2 ports (5V/1.5A) x2
		2.5GbE Ethernet port x1 3.5mm TRRS Audio jack x1
Power	Power Mode	External power source
	Power Adapter	Input: AC 100-240V
		Output: DC 20V/9A
Working Environment	Operation Temperature	0~35 degree
	Storage Temperature	-20~70 degree
Compliance	FCC/ CE/ RCM/ UKCA/ ICES-003/ VCCI/ BIS/ KC/ ERP	

Connection



Installation

1. Connect PG25 to the laptop with the included Thunderbolt 5 cable using the upstream Thunderbolt port 
2. Connect Thunderbolt/USB-C peripherals or monitors with Thunderbolt-C cables using downstream Thunderbolt ports 
3. Connect USB-A device to USB-A 10Gb/s port 
4. Plug in the DC power adapter to DC-In port
5. Press Power  button and green LED indicator should immediately display
6. Check if Amber LED indicator is lit for Thunderbolt connections
7. Press Power  button for 1 second to turn off the Dock